

# Manhole Inspection Summary

Manhole # S05AA2039MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **05AA2** Node: **039** Status: **Found**

Insp Date: **9/19/06 8:02 AM**

Incomplete Comments

Crew: **WM, JY**  
Inspector: **Morris, W**  
Firm: **RKK**

**Location** Address: **6002 WESTERN RUN DR**

Cross Street: **BAYWOOD AVE**

**Manhole** Type: **Junction** Location: **Grass**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments **One of the paragraph 8 sewers.**

**Cover** Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **4** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Precast Concrete** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Precast Concrete** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **11** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S05AA2039MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Corbel and Barre infiltration.

## Manhole Inspection Summary

Manhole # S05AA2039MH

Printed On: 12/17/2008

Page 3 of 4

### 27 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **15.11** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 24 in. Circular Gravity Sewer Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **14.73** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

# Manhole Inspection Summary


Manhole # S05AA2039MH

Printed On: 12/17/2008

Page 4 of 4

## 8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock

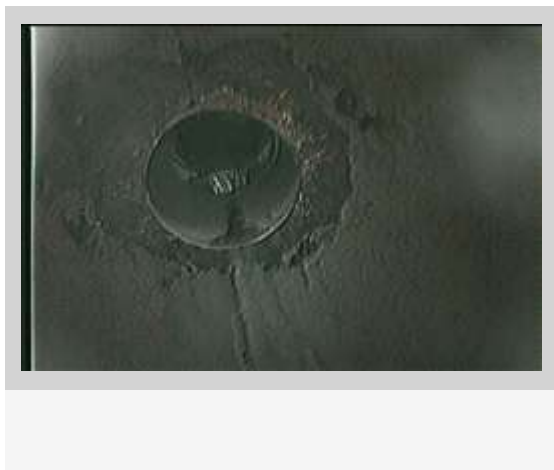

Drop In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **PVC**

☐ Pipe Lined

Invert Depth: **9.91** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.)

Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Cracked**

Drop: **Outside** Rod and Bar

Angled: **Yes**

Reading: **12.84** (ft.)

Inv Depth: **13.84** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection